

**Maggie Terry**  
**Legal Label Inc.**  
4 Whites Bridge Rd  
Suite #275  
Windham, Maine 04062  
United States

mterry@legallabel.com  
licensing@legallabel.com  
Normal (8-10 Days)  
Arrival Date: 18 May 2023  
Report Date: 22 May 2023

**Sample Type:** Mattress  
**Shipped By:** UPS 1Z40X9750344623505  
**Label:** Provided Label: COCONUT FIBER PAD ... 71%  
NATURAL TREE LATEX FOAM RUBBERPAD ... 24%  
POLYESTER FIBER BATTING ... 4%  
SPANDEX FIBER ... 1%

**Sample Identification:** URN RI 16555 (CA) - Enriquez  
Mattress

**Product Size:** 28 x 53 in.



This analysis represents (within normal testing variances) the test results from the sample(s) submitted. The analysis may not represent the entire lot, batch or production run. In no event shall IDFL be responsible or liable for any direct, indirect, punitive, incidental, special, or consequential damages whatsoever arising out of or connected with the use of, misuse of, or reliance upon such results or analysis. This test report is subject to the Terms and Conditions found at [www.idfl.com](http://www.idfl.com).

### IDFL LABORATORY AND INSTITUTE

**IDFL SALT LAKE**  
1455 South 1100 East  
Salt Lake City, UT 84105  
USA  
+1 801 467 7611  
[info@idfl.com](mailto:info@idfl.com)

**IDFL EUROPE AG**  
Zürcherstrasse 282  
CH-8500 Frauenfeld  
Switzerland  
+41 52 765 1574  
[europe@idfl.com](mailto:europe@idfl.com)

**IDFL CHINA**  
Tonghui Mid-Road 688, Xiaoshan  
Hangzhou Zhejiang 311200  
China  
+86 571 8273 6561  
[china@idfl.com](mailto:china@idfl.com)

**IDFL TAIPEI**  
8F, No. 312, Sec. 2  
New Taipei Blvd, Xinzhuang Dist  
New Taipei City, Taiwan  
+886-2-8522-8790  
[taiwan@idfl.com](mailto:taiwan@idfl.com)

**IDFL VIETNAM**  
No. 8, B4 Street An Loi Dong Ward  
District 2, Ho Chi Minh City  
Vietnam  
+84 282-244-7611  
[vietnam@idfl.com](mailto:vietnam@idfl.com)

Approved By  
  
[www.idfl.com](http://www.idfl.com)  
Client 6663  
SL  
Sample 1 of 1  
Page 1 of 3



Space needed for stitching	Space needed for stitching
<b>UNDER PENALTY OF LAW THIS TAG NOT TO BE REMOVED EXCEPT BY THE CONSUMER</b>  <b>ALL NEW MATERIAL</b> consisting of COCONUT FIBER PAD.....71% NATURAL TREE LATEX FOAM RUBBERPAD.....24% POLYESTER FIBER BATTING.....4% SPANDEX FIBER.....1%	Manufactured by: Enriquez Materials & Quilting 2200 Saybrook, AVE. Commerce, CA 90040  Date of Manufacture:  Model:  Prototype ID: 211-101sam  This mattress meets the requirements of 16 CFR Part 1633 (federal flammability (open flame) standard for mattress sets) when used without a foundation
<b>REG. NO. RI 16555 (CA)</b>  Certification is made by the manufacturer that the materials in this article are described in accordance with law	<b>THIS MATTRESS IS INTENDED TO BE USED WITHOUT A FOUNDATION</b>
<b>MADE FOR</b> Nook Sleep Systems 1840 Maryland Street Houston, TX 77006-1720  Date of Delivery _____ Finished Size: 28 x 53 in. Net Wgt. Of Filling Mat'l 25 lbs. 0 oz. <b>MADE IN USA OF IMPORTED AND DOMESTIC COMPONENTS</b>	Cover: Polyester...72%, Rayon...26%, Spandex...2% Inner Liner: Cotton...80%, Polyester..... 20%

23-485822

### SIDS AND SUFFOCATION HAZARDS

**Babies have suffocated:**

- on pillows, comforters, and extra padding
- in gaps between a wrong-sized mattress, or extra padding, and side walls of product.

**NEVER** add soft bedding, padding, or an extra mattress.

**USE ONLY** one mattress at a time.

**ALWAYS** check mattress fit **every time you change the sheets** by pushing mattress tight to one corner. Look for any gaps between the mattress and the side walls. If a gap is larger than 1 in (2.5 cm), do not use the mattress.

**ALWAYS** place baby on back to sleep to reduce the risks of SIDS and suffocation.

**DO NOT** cover the faces or heads of babies with a blanket or over bundle them. Overheating can increase the risk of SIDS.

**USE ONLY** sheets and mattress pads designed specifically for this mattress size.


**USE ONLY** with Babyletto Origami Mini Crib.

**This mattress measures 37" long, 23" wide and 3" thick when measured from seam to seam.**

**DO NOT** remove these important safety warnings.

GREEN MAGNET  
CAUTION—MAGNETIC DEVICE  
DO NOT USE WITH PACE MAKER

23-485822

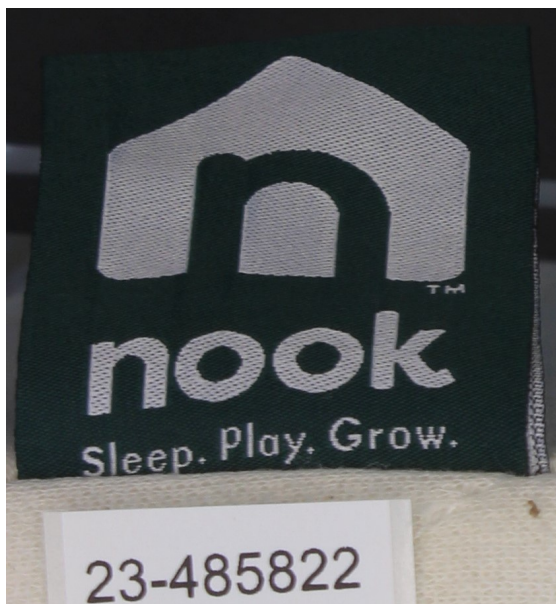

23-485822

This analysis represents (within normal testing variances) the test results from the sample(s) submitted. The analysis may not represent the entire lot, batch or production run. In no event shall IDFL be responsible or liable for any direct, indirect, punitive, incidental, special, or consequential damages whatsoever arising out of or connected with the use of, misuse of, or reliance upon such results or analysis. This test report is subject to the Terms and Conditions found at [www.idfl.com](http://www.idfl.com).

### IDFL LABORATORY AND INSTITUTE

#### IDFL SALT LAKE

1455 South 1100 East  
Salt Lake City, UT 84105  
USA  
+1 801 467 7611  
[info@idfl.com](mailto:info@idfl.com)

#### IDFL EUROPE AG

Zürcherstrasse 282  
CH-8500 Frauenfeld  
Switzerland  
+41 52 765 1574  
[europe@idfl.com](mailto:europe@idfl.com)

#### IDFL CHINA

Tonghui Mid-Road 688, Xiaoshan  
Hangzhou Zhejiang 311200  
China  
+86 571 8273 6561  
[china@idfl.com](mailto:china@idfl.com)

#### IDFL TAIPEI

8F, No. 312, Sec. 2  
New Taipei Blvd, Xinzhuang Dist  
New Taipei City, Taiwan  
+886-2-8522-8790  
[taiwan@idfl.com](mailto:taiwan@idfl.com)

#### IDFL VIETNAM

No. 8, B4 Street An Loi Dong Ward  
District 2, Ho Chi Minh City  
Vietnam  
+84 282-244-7611  
[vietnam@idfl.com](mailto:vietnam@idfl.com)

Approved By

[www.idfl.com](http://www.idfl.com)

Client 6663

SL

Sample 1 of 1

### State of Ohio Filling Inspection / Preparation

<b>Fill Type (1)</b>	<b>Coconut Fiber Pad</b>	<b>% of Total Filling Wt.</b>
Fiber Analysis:	<b>Coconut Fibers</b>	<b>75.7%</b>
Filling or Used as Structure?	<b>Filling</b>	
Location of Filling / Type in product	<b>Body</b>	
Detailed Location:	<b>Center Piece</b>	

<b>Fill Type (2)</b>	<b>Rubber Pad</b>	<b>% of Total Filling Wt.</b>
Fiber Analysis:	<b>Rubber/natural latex</b>	<b>18.7%</b>
Filling or Used as Structure?	<b>Filling</b>	
Location of Filling / Type in product	<b>Body</b>	
Detailed Location:	<b>On top of the Coconut fiber pad</b>	

<b>Fill Type (3)</b>	<b>Fiber Batting</b>	<b>% of Total Filling Wt.</b>
Fiber Analysis:	<b>Polyester Rayon / Viscose</b>	<b>5.6%</b>
Filling or Used as Structure?	<b>Filling</b>	
Location of Filling / Type in product	<b>Body</b>	
Detailed Location:	<b>Under shell fabric</b>	

### Fiber Analysis: Quantitative AATCC 20A 2014

#### Fill Type (1) Coconut Fiber Pad

Other 100.0%

Comments: Coconut Fibers

#### Fill Type (2) Rubber Pad

Other 100.0%

Comments: Rubber/natural latex

#### Fill Type (3) Fiber Batting

polyester 26.8%

rayon / viscose 73.2%

This analysis represents (within normal testing variances) the test results from the sample(s) submitted. The analysis may not represent the entire lot, batch or production run. In no event shall IDFL be responsible or liable for any direct, indirect, punitive, incidental, special, or consequential damages whatsoever arising out of or connected with the use of, misuse of, or reliance upon such results or analysis. This test report is subject to the Terms and Conditions found at [www.idfl.com](http://www.idfl.com).

#### IDFL LABORATORY AND INSTITUTE

**IDFL SALT LAKE**  
1455 South 1100 East  
Salt Lake City, UT 84105  
USA  
+1 801 467 7611  
[info@idfl.com](mailto:info@idfl.com)

**IDFL EUROPE AG**  
Zürcherstrasse 282  
CH-8500 Frauenfeld  
Switzerland  
+41 52 765 1574  
[europe@idfl.com](mailto:europe@idfl.com)

**IDFL CHINA**  
Tonghui Mid-Road 688, Xiaoshan  
Hangzhou Zhejiang 311200  
China  
+86 571 8273 6561  
[china@idfl.com](mailto:china@idfl.com)

**IDFL TAIPEI**  
8F, No. 312, Sec. 2  
New Taipei Blvd, Xinzhuang Dist  
New Taipei City, Taiwan  
+886-2-8522-8790  
[taiwan@idfl.com](mailto:taiwan@idfl.com)

**IDFL VIETNAM**  
No. 8, B4 Street An Loi Dong Ward  
District 2, Ho Chi Minh City  
Vietnam  
+84 282-244-7611  
[vietnam@idfl.com](mailto:vietnam@idfl.com)

Approved By

[www.idfl.com](http://www.idfl.com)

Client 6663

SL

Sample 1 of 1